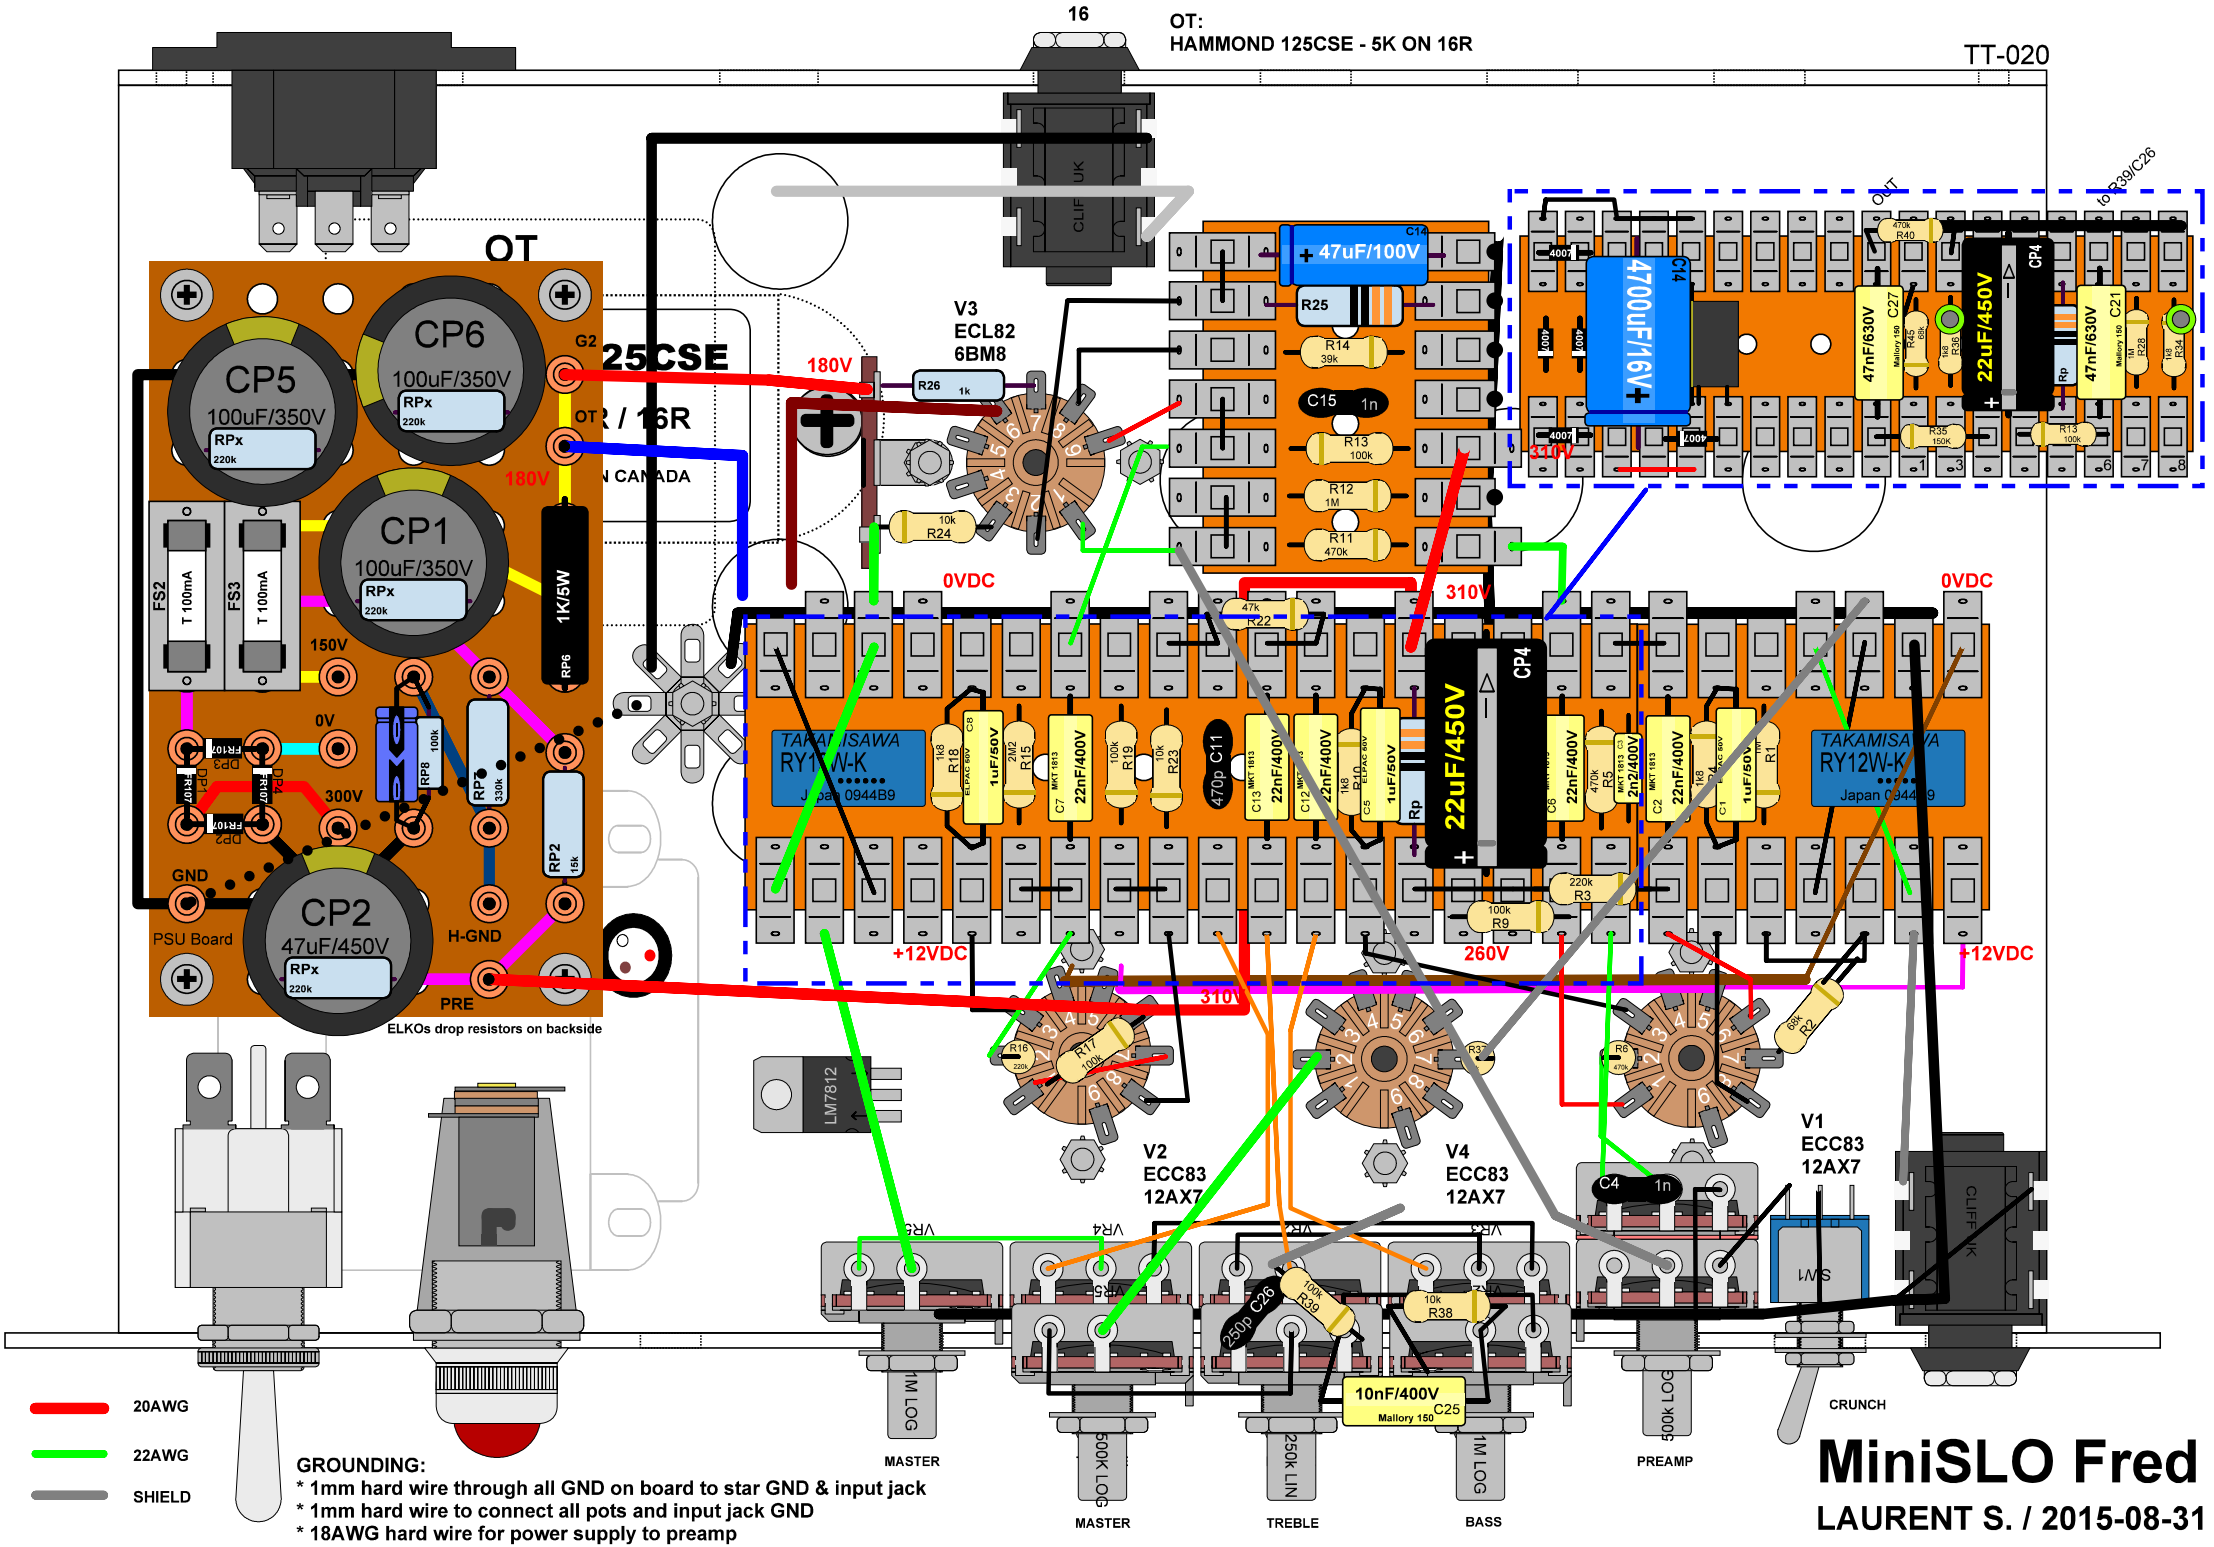
16
OT:
HAMMOND 125CSE - 5K ON 16R
TT-020
OT
CP5
100uF/350V
RPx
220k
CP6
100uF/350V
RPx
220k
CP1
100uF/350V
RPx
220k
CP2
47uF/450V
RPx
220k
G2
25CSE
OT / 16R
N CANADA
180V
1K/5W
RP6
FS2
T 100mA
FS3
T 100mA
150V
0V
300V
GND
PSU Board
H-GND
PRE
RP8
100k
RP7
330k
RP2
15k
ELKOs drop resistors on backside
V3
ECL82
6BM8
R26
1k
R24
10k
180V
0VDC
310V
+12VDC
260V
47uF/100V
C14
R25
R14
39k
C15
1n
R13
100k
R12
1M
R11
470k
4700uF/16V
C14
4007
OUT
to R39/C26
47nF/630V
C27
22uF/450V
CP4
47nF/630V
C21
R40
470k
R35
150K
R13
100k
R28
R34
TAKAMISAWA
RY12W-K
Japan 0944B9
1uF/50V
22nF/400V
470p C11
22uF/450V
CP4
R22
47k
R18
1k8
R15
2M2
C7
R19
100k
R23
10k
C13
C12
R10
1k8
C5
Rp
C6
R5
470k
2n2/400V
C2
C1
R1
R3
220k
R9
100k
R16
220k
R17
100k
R37
R6
470k
R2
68k
LM7812
V2
ECC83
12AX7
V4
ECC83
12AX7
V1
ECC83
12AX7
C4
1n
VR5
VR4
VR2
VR3
250p C26
R39
100k
R38
10k
10nF/400V
C25
Mallory 150
1M LOG
500K LOG
250k LIN
1M LOG
500k LOG
MASTER
MASTER
TREBLE
BASS
PREAMP
CRUNCH
20AWG
22AWG
SHIELD
GROUNDING:
* 1mm hard wire through all GND on board to star GND & input jack
* 1mm hard wire to connect all pots and input jack GND
* 18AWG hard wire for power supply to preamp
MiniSLO Fred
LAURENT S. / 2015-08-31